

**FORM**  
**6**  
Rev  
05/18

**State of Colorado**  
**Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 401782812			
Date Received: 10/03/2018			

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.  
A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CHERYL LIGHT  
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461  
 Address: P O BOX 173779 Fax: (720) 929-7461  
 City: DENVER State: CO Zip: 80217- Email: cheryl.light@anadarko.com

**For "Intent" 24 hour notice required,** Name: Carlile, Craig Tel: (970) 629-8279  
**COGCC contact:** Email: craig.carlile@state.co.us

API Number 05-123-31117-00 Well Number: 8-36  
 Well Name: CARMA  
 Location: QtrQtr: NWNE Section: 36 Township: 3N Range: 68W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: -1  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon  Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.187608 Longitude: -104.946551  
 GPS Data:  
 Date of Measurement: 09/12/2011 PDOP Reading: 2.7 GPS Instrument Operator's Name: Renee Doiron  
 Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: 430  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7486	7504			
J SAND	7932	7956			
NIOBRARA	7234	7352			

Total: 3 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	840	530	840	0	VISU
1ST	7+7/8	4+1/2	11.6	8,077	225	8,077	6,475	CBL
			Stage Tool	5,209	655	5,220	467	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7860 with 2 sacks cmt on top. CIPB #2: Depth 7170 with 25 sacks cmt on top.  
CIBP #3: Depth 4020 with 2 sacks cmt on top. CIPB #4: Depth 80 with 25 sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 7170 ft. to 6820 ft. Plug Type: CASING Plug Tagged:   
Set 10 sks cmt from 5259 ft. to 5159 ft. Plug Type: CASING Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)  
Set 80 sacks half in. half out surface casing from 940 ft. to 380 ft. Plug Tagged:   
Set 25 sacks at surface  
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
of \_\_\_\_\_  
\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
Type of Cement and Additives Used: \_\_\_\_\_  
Flowline/Pipeline has been abandoned per Rule 1105  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT  
Title: Staff Regulatory Analyst Date: 10/3/2018 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McCoy, Diane Date: 11/15/2018

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: 5/14/2019

<b>COA Type</b>	<b>Description</b>
	<p>1) Provide 48 hour notice of plugging MIRU via electronic Form 42.</p> <p>2) Properly abandon on-location flowlines per Rule 1105. File electronic Form 42 once abandonment complete. Within 30 days of an operator completing abandonment requirements for an off-location flowline or crude oil transfer line the operator must submit a Flowline Report, Form 44.</p> <p>3) Operator shall implement measures to control unnecessary and excessive venting, to protect the health and safety of the public, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact COGCC engineering for verification of plugging procedure.</p>

### **Attachment Check List**

<b>Att Doc Num</b>	<b>Name</b>
401782812	WELL ABANDONMENT REPORT (INTENT)
401783299	PROPOSED PLUGGING PROCEDURE
401783300	WELLBORE DIAGRAM
401841861	FORM 6 INTENT SUBMITTED

Total Attach: 4 Files

### **General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
Engineer	<p>Production records indicate this well has been SI since December 2016. All shut-in wells must pass a mechanical integrity test or be plugged and abandoned within two years of the initial shut-in date, this form 6 intent does not extend that due date.</p> <p>DWR's aquifer determination tool base of Laramie-Fox Hills = 111'</p> <p>Deepest water well within one mile = 150'</p> <p>Added plug to cover stage tool.</p>	11/15/2018
Permit	Passed permit review	10/10/2018
Well File Verification	Pass	10/10/2018

Total: 3 comment(s)